

BT54.15-D-2601-01A	Hydraulic pump relay equipment for sprintshift transmission modified		
--------------------	--	--	--


**MODELS**

**901.6, 902.6, 903.6, 904.6  
with TRANSMISSION 716.643  
with CODE (GD5) Automated  
manual transmission 716.643**

In vehicles as of VIN end no. R 453 444, diode AK330 is installed as standard in combination with relay K84 (make Hella, part number 002 542 13 19).

In vehicles up to VIN end no. R 238 044, diode AK330 **must** be installed in combination with relay K84 (make Hella, part number 002 542 13 19).

In vehicles as of VIN end no. R 238 045 to R 453 443, existing relay K84, manufactured by Tyco (part number 002 542 13 19) or manufactured by Hella (part number 002 542 23 19) must be changed to relay 002 542 59 19 to prevent damaging the sprintshift hydraulic pump.

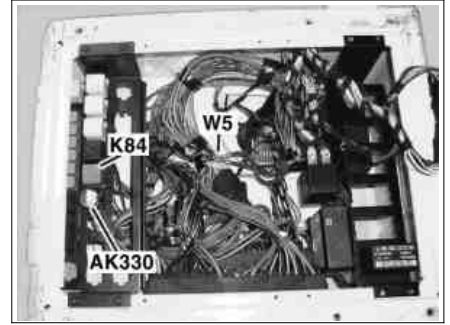

D26.19-1143-01

On vehicles as of VIN end no. 238 045 with existing diode AK330, relay K84 (manufactured by Hella, part number 02 542 59 19) can be installed without modification.

**i** A rectifier diode is integrated in the relay 002 542 59 19.